



Applies To: **1998-01 Prelude - ALL**

October 30, 2001

Prelude: MIL Comes On With DTC P0133

SYMPTOM

The MIL is on with DTC P0133 (primary heated oxygen sensor slow response) stored.

PROBABLE CAUSE

The primary heated oxygen sensor malfunctions.

CORRECTIVE ACTION

Replace the primary heated oxygen sensor.

PARTS INFORMATION

Oxygen Sensor (Prelude):
P/N 36531-P5M-014, H/C 6015903

Oxygen Sensor (Type-SH):
P/N 36531-P5P-014, H/C 6015911

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

OP#	Description	FRT	Template ID
121170	Replace oxygen sensor (Prelude)	0.3	01-093A
123503	Use the PGM Tester to clear codes	0.3	
121170	Replace oxygen sensor (Type-SH)	0.3	01-093B
123503	Use the PGM Tester to clear codes	0.3	

Failed Part: P/N 36531-P5M-014
Prelude H/C 6015903

Failed Part: P/N 36531-P5P-014
Type-SH H/C 6015911

Defect Code: 072


Contention Code: B03

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Confirm the DTC with the PGM Tester.
2. Disconnect the primary heated oxygen sensor 4P connector.
3. Remove and replace the oxygen sensor with the appropriate part.

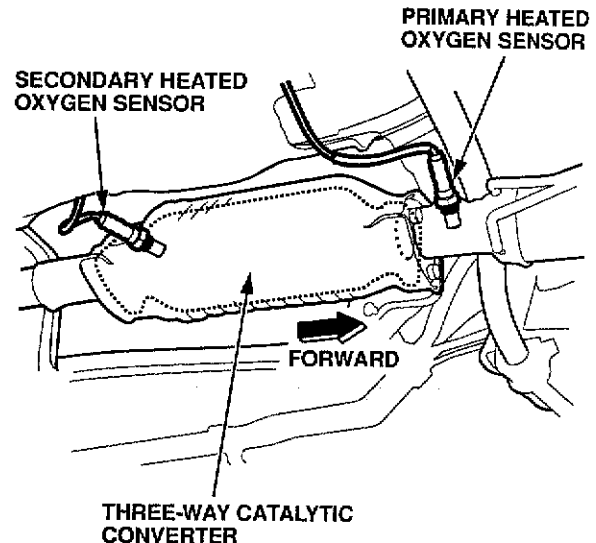

4. Reconnect the oxygen sensor 4P connector.
5. Use the PGM Tester to clear any DTCs.



CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.