



Applies To: 1997 Prelude Type SH – Thru VIN JHMBB6 . . . VC007624

March 17, 1997

ATTS Light On / DTC 78: Vehicle Inventory Update

PROBLEM

The ATTS control unit may occasionally turn on the instrument panel ATTS indicator, shut down the system, and store a DTC 78 when there is no real problem.

CORRECTIVE ACTION

Customer Complaint of ATTS Indicator On

Inspect the part number of the ATTS control unit. Replace it if it is not an updated unit. If it is an updated unit, follow normal troubleshooting procedures.

Vehicles in Inventory or Scheduled Maintenance

Affected vehicles in dealers' inventories should be inspected and updated prior to retail sale. Affected vehicles already sold should be inspected and updated when they are brought in for scheduled maintenance.

PARTS INFORMATION

ATTS control unit:

P/N 48310-P5P-013, H/C 5368683

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

| OPERATION NUMBER | DESCRIPTION | FLAT RATE TIME | TEMPLATE ID |
|------------------|--------------------------------------|----------------|-------------|
| 219501 | Inspect control unit P/N only | 0.2 | 97-024A |
| 219109 | Inspect and replace the control unit | 0.6 | 97-024B |

Failed part: P/N 48310-P5P-003
H/C 5294400

Defect code: 074

Contention code: D06


Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

Control Unit Inspection

1. Remove the passenger's side door sill molding and kick panel (see service manual page 20-41).
2. Pull back the carpeting. Read the part number of the ATTS control unit through the hole in the upper left corner of the ECM cover.

ATTS CONTROL UNIT
P/N 48310-P5P-003 = Replace
or
P/N 48310-P5P-013 = OK

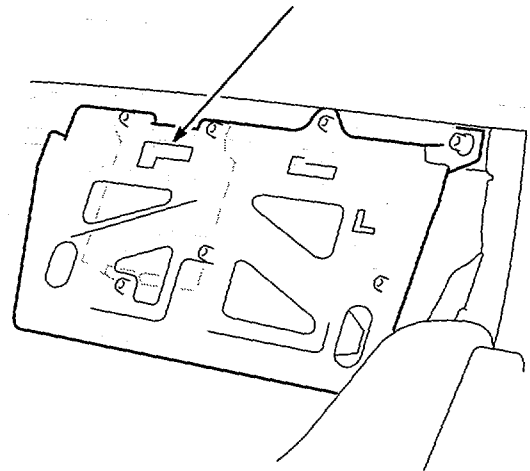


- If the part number is 48310-P5P-013, it is an updated unit. Reinstall all removed parts, and return the vehicle to the customer.
- If the part number is 48310-P5P-003, it is not an updated unit. Continue to **Control Unit Replacement**.

048650

Control Unit Replacement

1. Make sure you have the anti-theft code for the audio system. Record the customer's radio station presets.
2. Disconnect the cable from the battery negative terminal.
3. Remove the four ECM cover mounting nuts. Lift the cover.
4. Disconnect the two electrical connectors from the ATTS control unit.

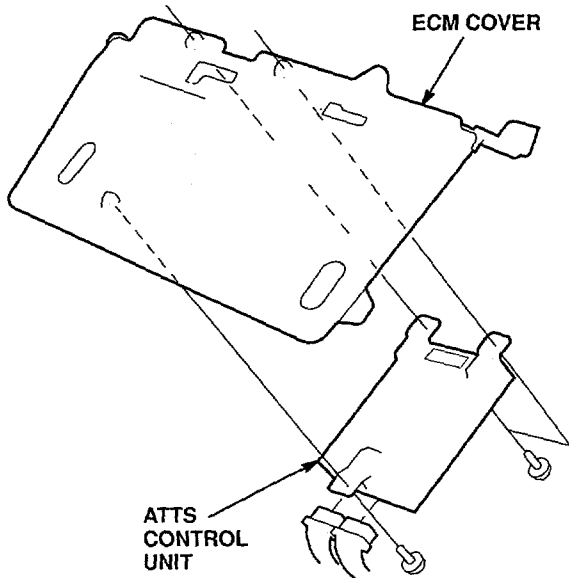

5. Remove the ATTS control unit from the ECM cover (three bolts).
6. Install the new ATTS control unit (see PARTS INFORMATION) with the original bolts. Reinstall the ECM cover.
7. Put the carpet back in place. Install the kick panel and door sill molding.
8. Reconnect the cable to the battery negative terminal.
9. Enter the anti-theft code in the audio system. Enter the customer's radio station presets. Set the clock.
10. Jump the SCS service check connector, and look for any stored Diagnostic Trouble Codes (see service manual page 15-14).

NOTE: For the following steps, refer to service bulletin 97-023, *ATTS Service Procedures*. The procedures in section 15 of the service manual are incorrect.

11. Clear any DTCs that are stored.
12. Perform the Memorizing the Steering Angle Sensor Neutral Position procedure.
13. Perform the ATTS Function Test.