

# SERVICE BULLETIN

**HONDA**

Model	Applicable To	File Under	Bulletin No.
1992 - 95 PRELUDE 1992 - 93 CIVIC 4-DOOR	See VEHICLES AFFECTED	BODY	92-047
			Issue Date
			OCT 24, 1994

## Rearview Mirror Reinstallation (Supersedes 92-047, dated November 30, 1992)

### PROBLEM

The rearview mirror may be accidentally knocked off the windshield lug and some of the internal parts can be broken or lost.


### VEHICLES AFFECTED

- NEW**
- 1992 - 95 Prelude:  
All Japan-produced vehicles
  - 1992 - 93 Civic:  
All Japan-produced vehicles

### CORRECTIVE ACTION


Replace any missing or damaged parts (see PARTS INFORMATION), and reinstall the rearview mirror.

1. Remove the lock bolt from the mirror stay as described in the appropriate service manual.
2. Inspect the hook plate. If the hook plate is distorted, bend it to its original 90° position.

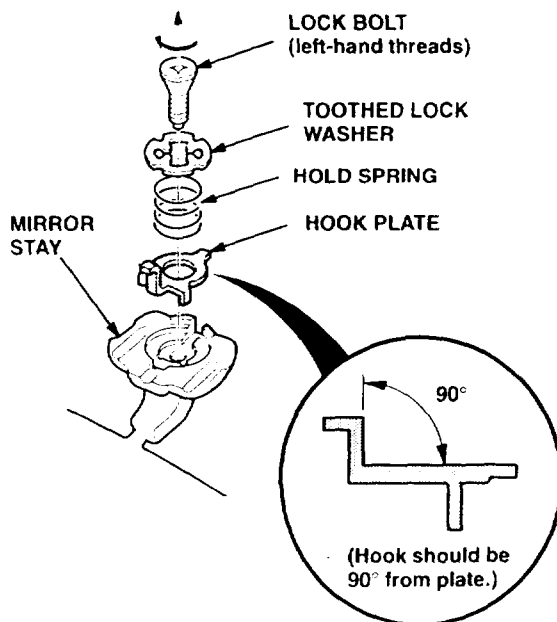

3. Inspect the lock bolt, the toothed washer, and the hold spring. Replace any parts that are missing, broken, or distorted (see PARTS INFORMATION).

4. Loosely install the hook plate, hold spring and the toothed washer to the mirror stay using the lock bolt. Make sure the hook plate is over the top of the toothed washer. Thread in the lock bolt until the toothed washer is approximately 5 mm from the mirror stay.

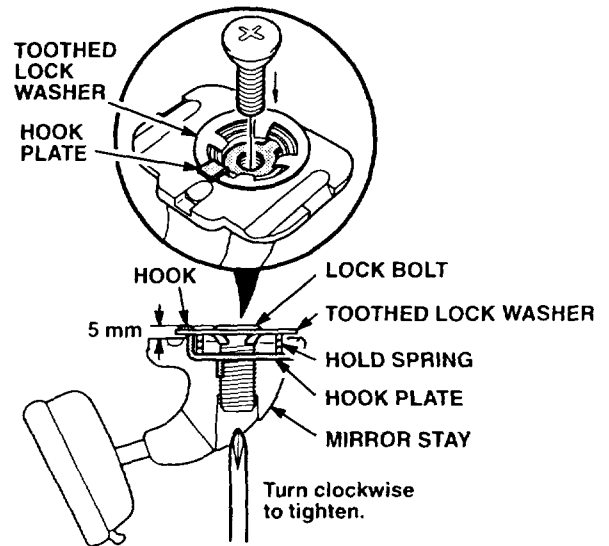

5. Install the mirror on the windshield lug, and torque the lock bolt to 2.0-3.0 N-m (20-30 kg-m, 14-22 lb-ft).

### PARTS INFORMATION

#### Civic

Description	P/N	H/C
Lock bolt	76410-SL4-003	3552841
Toothed washer	76409-SL0-003	3586583
Hold spring	76419-SL4-003	4282562 <b>NEW</b>

#### Prelude

Description	P/N	H/C
Lock bolt	76410-SL4-003	3552841
Toothed washer	76410-SP0-003	3665403
Hold spring	76419-SL4-003	4282562 <b>NEW</b>

Index # **039988**

ATB 15607-16797 (9410)

1 of 2

This bulletin is intended for use *only* by skilled technicians who have the proper tools.

**WARRANTY CLAIM INFORMATION**

**In warranty:** The normal warranty applies.

**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

Operation number: 828155

Flat rate time: 0.2 hour

Failed part: P/N 76400-SR0-A02ZA  
H/C 3890738

Defect code: 018

Contention code: B99