

SERVICE BULLETIN

HONDA
AUTOMOBILE SERVICE DEPARTMENT

Model	Applicable To	File Under	Bulletin I
1988 - 93 PRELUDE	ALL	BODY	93-00
			Issue Date
			FEB 12,

Jingling Noise From Rear

SYMPTOM

A jingling noise is heard from the rear when driving on bumpy roads.


PROBABLE CAUSE

The sounds of the rear suspension springs and damper valves working are being transmitted into the passenger compartment.

CORRECTIVE ACTION

Insulate the top of the rear dampers with EPT.

1. Remove the trunk side trim panels.
2. Cut four 15-inch-long pieces of EPT 10T sealer.
3. Apply two overlapping pieces of the EPT 10T sealer over the top of a rear damper and mount. Leave some clearance above the center rod so the damper does not pull the sealer loose as it moves up and down.

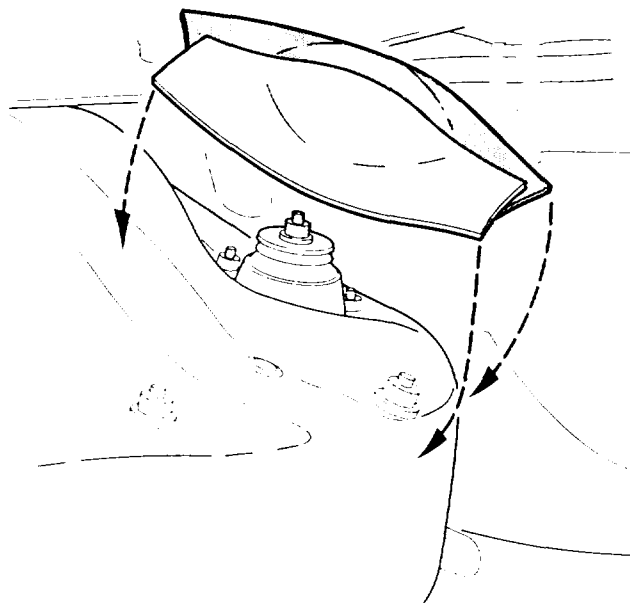

4. Repeat step 3 on the other rear damper.
5. Reinstall the trunk side trim panels.

PARTS INFORMATION

EPT 10T Sealer P N 06992-SA5-000
H C 2086668

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Out of warranty: Any repair performed a warranty expiration may be eligible for good consideration by the District Service Manager. must request consideration, and get the DS decision, before starting work.

Operation number: 417725

Flat rate time: 0.7 hour per car

Failed part: P N 52611-SS0-903
H C 3945425

Defect code: C42

Contention code: B07

Index : **032657**