

SERVICE BULLETIN

HONDA
AUTOMOBILE SERVICE DEPARTMENT

Model 1992 - 93 PRELUDE	Applicable To ALL	File Under BODY	Bulletin No. 93-001
			Issue Date JAN 15, 1993

Loose Door Seal

PROBLEM

The seal around the door opening has come loose from the body.

CORRECTIVE ACTION

Reinstall the door seal with adhesive.

1. Pull the door seal away from the door opening flange in the affected area. Clean the door opening flange with 3M General Purpose Adhesive Cleaner (P/N 051135-08984) or equivalent.
2. Apply a *thin* coat of 3M Weatherstrip Adhesive (P/N 051135-08011) to the door seal and to the door opening flange. Allow the adhesive to dry until tacky.

NOTE: Applying too much adhesive or attaching the seal before the adhesive becomes tacky may allow the seal to come loose again.

3. After allowing the adhesive on both surfaces to become tacky, press the door seal back in place on the door opening flange.

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.



Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager. You must request consideration, and get the DSM's decision, before starting work.

OPERATION NUMBER	DESCRIPTION	FLAT RATE TIME
835700	Reinstall one door seal with adhesive	0.2 hour
A	For both sides, add	0.1 hour

Failed part: P/N 72355-SS0-003
H/C 3949203

Defect code: 061

Contention code: A02

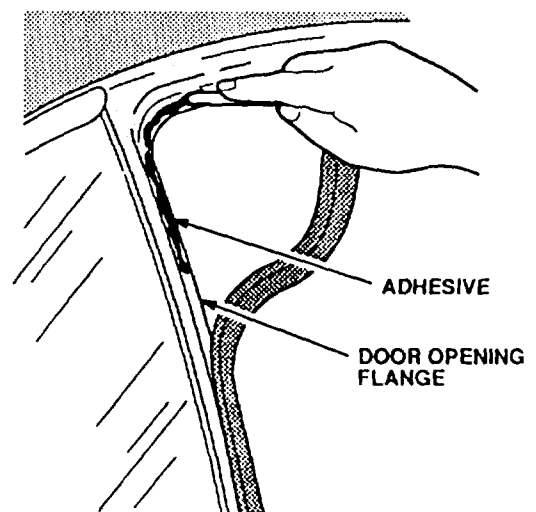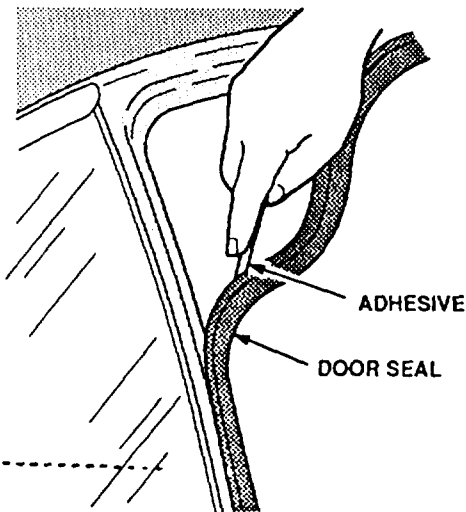

Index #

032331